


□ Other

APPLICATION FOR APPEAL

Saint Paul City Clerk

310 City Hall, 15 W. Kellogg Blvd. Saint Paul, Minnesota 55102 Telephone: (651) 266-8560

te and Time: / 4 Courthouse			
N Zip: 55/06			
Appellant/Applicant: Xai Xiong Email Xaibillions @ Yahoo Com			
1-353-6611			
8-10			
Acceptable			
dor order #16)			

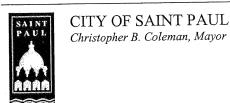

375 Jackson Street, Suite 220 Saint Paul, Minnesota 55101-1806

 Telephone:
 651-266-8989

 Facsimile:
 651-266-8951

 Web:
 www.stpaul.gov/dsi

September 2, 2010

XAI XIONG 7035 STRATFORD ECHO WOODBURY MN 55125

FIRE INSPECTION CORRECTION NOTICE

RE:

961 WILSON AVE

Ref. #14756

Residential Class: C

Dear Property Representative:

Your building was inspected on September 1, 2010 for the renewal of your Fire Certificate of Occupancy. Approval for occupancy will be granted upon compliance with the following deficiency list. The items on the list must be corrected prior to the re-inspection date.

A re-inspection will be made on October 1, 2010 at 2:00 pm.

Failure to comply may result in a criminal citation or the revocation of the Fire Certificate of Occupancy. The Saint Paul Legislative Code requires that no building shall be occupied without a Fire Certificate of Occupancy. The code also provides for the assessment of additional reinspection fees.

YOU WILL BE RESPONSIBLE FOR NOTIFYING TENANTS IF ANY OF THE FOLLOWING LIST OF DEFICIENCIES ARE THEIR RESPONSIBILITY.

DEFICIENCY LIST

- 1. EXTERIOR SPLC 34.09 (1) b,c, 34.32 (1) b,c Provide and maintain all exterior walls free from holes and deterioration. All wood exterior unprotected surfaces must be painted or protected from the elements and maintained in a professional manner free from chipped or peeling paint.-Scrape and paint house trim in a professional manner.
- 2. EXTERIOR SPLC 34.09 (1) e, 34.32 (1) d Provide and maintained the roof weather tight and free from defects.-Repair holes in eaves and replace missing fascia in a professional manner. Permit may be required.

- 3. EXTERIOR SPLC 34.08 (1), 34.31 (1) All exterior property areas shall be maintained free from any accumulation of refuse, garbage or feces.
- 4. EXTERIOR SPLC 34.09 (3), 34.32 (3) Repair and maintain the door in good condition.-Replace door to back stairs.
- 5. EXTERIOR SPLC 34.09 (3), 34.32 (3) Provide or repair and maintain the window screens.
- 6. EXTERIOR SPLC 34.09 (3), 34.32 (3) Repair and maintain the window glass.- Replace all broken windows.
- 7. EXTERIOR SPLC 34.09 (3), 34.32 (3) Repair and maintain the window frame.-Repair window frame in NE bedroom of 961 Unit 1, in a professional manner.
- 8. INTERIOR 961 UNIT 2 MSFC 605.1 Repair or replace damaged electrical fixtures. This work may require a permit(s). Call DSI at (651) 266-9090.-Repair damaged electric socket in kitchen. Permit may be required.
- 9. INTERIOR 963 UNIT 2 SPLC 34.10 (7), 34.33 (6) Repair and maintain the floor in an approved manner.-Repair floor covering in kitchen in a professional manner.
- 10. INTERIOR ALL UNITS MN State Statute 299F.50 Immediately provide and maintain an approved Carbon Monoxide Alarm in a location within ten (10) feet of each sleeping area. Installation shall be in accordance with manufacturers instructions.
- 11. INTERIOR ALL UNITS MN Stat. 299F.362 Immediately provide and maintain a smoke detector located outside each sleeping area.
- 12. INTERIOR ALL UNITS MSFC 605.5 Discontinue use of extension cords used in lieu of permanent wiring.
- 13. INTERIOR ALL UNITS NEC 440.13 For cord-connected equipment such as room air conditioners, household refrigerators and freezers, drinking water coolers, and beverage dispensers, a separable connector or an attachment plug and receptable shall be permitted to serve as the disconnecting means. The appliance must plug directly into a permanent outlet.-Air conditioners must be plugged directly into a permanent outlet. Microwave in 963 Unit 1 must be plugged directly into a permanent outlet.
- 14. INTERIOR ALL UNITS MSFC 605.4 Discontinue use of all multi-plug adapters.
- 15. INTERIOR ALL UNITS MSFC 605.1- All light fixtures shall be maintained with protective globes if originally equipped.

- 16. INTERIOR ALL UNITS MSFC1026.1 Provide and maintain an approved escape window from each sleeping room. The minimum size must be 5 square feet of glazed area with a minimum of 24 inches of openable height and 20 inches of openable width. With a finished sill height not more than 48 inches. This work may require permit(s). Call DSI at (651)- 266-9090. Refer to the Escape Windows for Residential Occupanices handout for more information.-Remove all materials obstructing bedroom windows. Unable to measure egress windows at time of inspection due to obstructions in 963. 961 Unit 2: window in south bedroom measured 15 inches openable height x 30 inches openable width. Window in north bedroom measured 19 inches openable height x 20 inches openable width. 961 Unit 1: window in Unit 1 measured 19.5 inches openable height x 31 inches openable width.
- 17. INTERIOR ALL UNITS MSFC 1011.2 Remove the materials that cause an exit obstruction. Maintain a clear and unobstructed exitway.-Remove all items obstructing bedroom egress windows.
- 18. INTERIOR SPLC 34.09 (3), 34.32 (3) Repair and maintain the window sashes.
- 19. INTERIOR SPLC 34.12 (2), 34.35 (1) Repair and maintain all required and supplied equipment in an operative and safe condition.-Repair closet door that is off the hinges at the top of the stairs leading to 961 Unit 2.
- 20. INTERIOR MN Stat 299F.18 Immediately remove and discontinue excessive accumulation of combustible materials.-Immediately remove propane tanks from the back stairs of 963.
- 21. INTERIOR SPLC 34.10 (7), 34.33 (6) Repair and maintain the walls in an approved manner.-Repair hole in wall behind kitchen sink in 963 Unit 1. Remove mold-like substance from wall and ceiling in back entry of 961.
- 22. INTERIOR MSFC 1003.3.1.8 Remove unapproved locks from the unit doors. The door must be openable from the inside without the use of keys or special knowledge or effort.-Remove slide locks from back door of 963 Unit 2, and from bedroom door of 963 Unit 1.
- 23. INTERIOR SPLC 34.09 (3) i Provide and maintain an approved one-inch throw single cylinder deadbolt lock.-Provide deadbolt for back door of 963 Unit 2.
- 24. SPLC 34.11 (6), 34.34 (3) Provide service of heating facility by a licensed contractor which must include a carbon monoxide test. Submit a completed copy of the Saint Paul Fire Marshal's Existing Fuel Burning Equipment Safety Test Report to this office.
- 25. SPLC 39.02(c) Complete and sign the provided smoke detector affidavit and return it to this office.

For an explanation or information on some of the violations contained in this report, please visit our web page at: http://www.ci.stpaul.mn.us/index.aspx?NID=211

You have the right to appeal these orders to the Legislative Hearing Officer. Applications for appeals may be obtained at the Office of the City Clerk, 310 City Hall, City/County Courthouse, 15 W Kellogg Blvd, Saint Paul MN 55102 Phone: (651-266-8688) and must be filed within 10 days of the date of this order.

If you have any questions, email me at: kelly.booker@ci.stpaul.mn.us or call me at 651-266-8985 between 7:30 a.m. - 9:00 a.m. Please help to make Saint Paul a safer place in which to live and work.

Sincerely,

Kelly Booker Fire Inspector

Reference Number 14756