
This is the interior, east side wall during the second visit.



Interior East side wall, different angle. Note the piping. Second inspection.



Interior carriage house east side wall on second inspection.

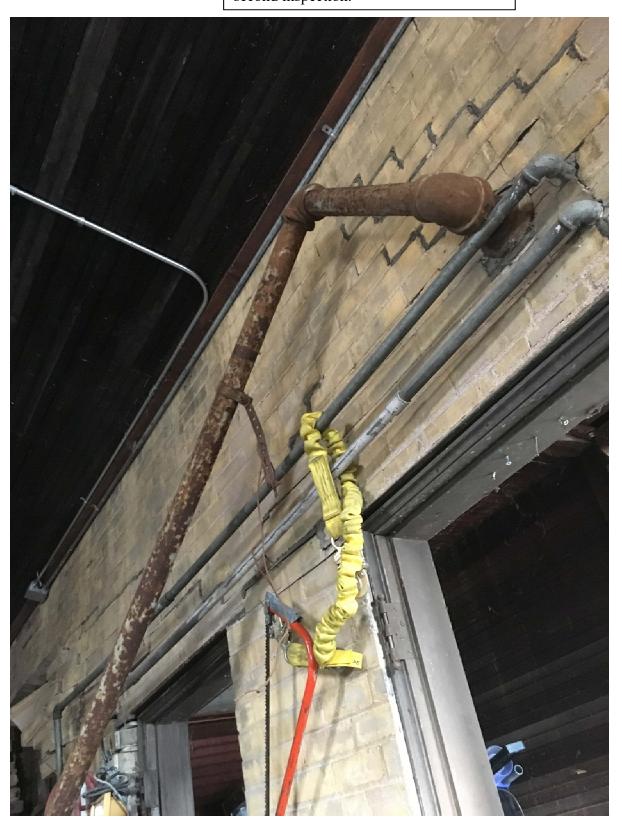

Interior carriage house east side wall on second inspection.




Furnace inside the main house that was not working during second inspection.



Kitchen remodel in the main house not done under permit.



Kerosene heater in main house bedroom.

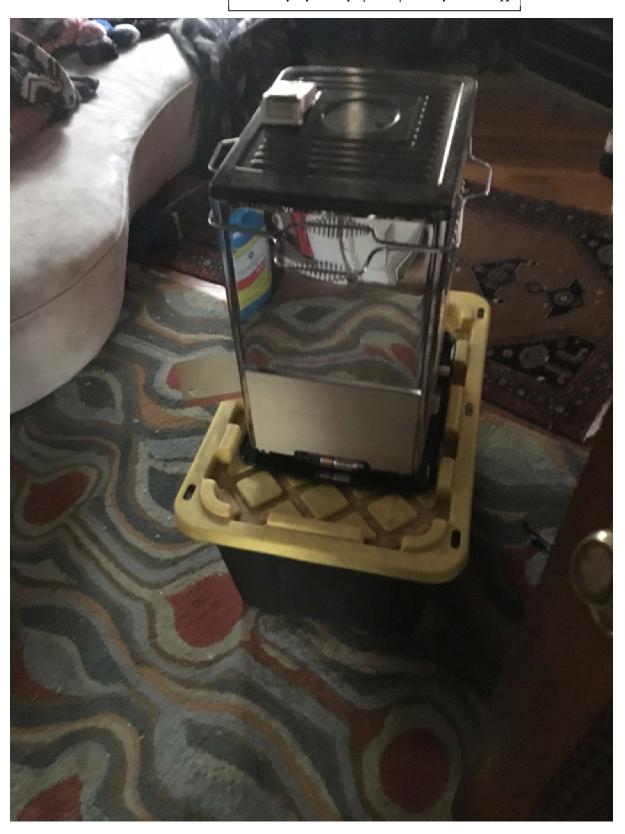

Kerosene heater in main house bedroom.



Propane heater inside main house bedroom.

