



525 Ohio St.
St. Paul, MN 551067
EA761612
651-222-8744

Inspection Report for: 188 Acker St. E Saint Paul, MN

1. Bushing needed to make safe



2. Box required for light fixture in basement.



3. Fan tied into old knob and tube wiring, requires new wiring to circuit not on knob and tube



4. Outlet has no power, more investigation needed or removal of outlet.



5. Knob and tube tied into informative note only likely no action needed.



6. Box not secure to wall, required to attach box securely to wall.



7. Switch is not rated for outdoor/wet location new cover listed for use in wet location required.



8. Open splice in attic, all splices required to be inside a listed electrical box.



9. Bushing required at main electrical panel.



10. Bushing required in basement junction box.



11. Hood power cord improperly installed, risk of shorting circuit. Requires dedicated hood circuit and accesable outlet or hard wiring of hood.



12. Outlets without grounding, require GFCI/AFCl device and “No Equipment Ground” Label on device.