1.0	
MM DD	YYYY Delete NFIRS -1
62210 MN 11 23	2013 07 13-0034597 000 Change Basic
FDID * State * Incident Date *	Station Incident Number * Exposure * No Activity
	icate that the address for this incident is provided on the Wildland Fire Census Tract 0306 - 01
B Location* Module In Section B "	Alternative Location Specification". Use only for Wildland fires.
X Street address	
	ARKWRIGHT
Manuel/Milepose Fiells	Street or Highway Street Type Suffix
In front of	NT PAUL MN 55130 -
Rear of Apt./Suite/Room City	State Zip Code
Adjacent to	
Directions Cross street or direct	tions, as applicable
a Taridani Mana	E1 Date & Times Midnight is 0000 E2 Shift & Alarms
C Incident Type *	ET 2000 a 11mon
111 Building fire	Check boxes if Month Day Year Hr Min Sec Local Option dates are the
Incident Type	same as Alarm ALARM always required
D Aid Given or Received*	Date. Alarm * 11 23 2013 13:48:34 shift or Alarms District
	ARRIVAL required, unless canceled or did not arrive
1 Mutual aid received	
2 Automatic aid recv. Their FDID Their	
3 Mutual aid given	CONTROLLED Optional, Except for wildland fires Special Studies
4 Automatic aid given	Controlled Local Option
5 Other aid given Their	LAST UNIT CLEARED, required except for wildland fires
N X None	Last Unit X 11 23 2013 18:16:20 Special Study ID# Study Value
<u> </u>	X Cleared 11 23 2013 18:16:20 Study Value
F Actions Taken *	G1 Resources * G2 Estimated Dollar Losses & Values
F Actions Taken *	
	X Check this box and skip this section if an Apparatus or for non fires. None
	Personnel form is used.
Primary Action Taken (1)	Apparatus Personnel Property \$, 100, 000
	Suppression 0015 Contents \$, 050 , 000
	, , , , , , , , , , , , , , , , , , , ,
Additional Action Taken (2)	EMS PRE-INCIDENT VALUE: Optional
	Other
	Property \$, 000 , 000
Additional Action Taken (3)	Check box if resource counts include aid received resources. Contents \$, 000 , 000
	Ψ Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι Ι
Completed Modules H1* Casualties	None H3 Hazardous Materials Release I Mixed Use Property
X Fire-2 Deaths Inju	NN None
↓ ==	10 Assembly use
Service	
Civil Fire Cas4	40 Boardontial van
Fire Serv. Cas5 Civilian	3 Gasoline: vehicle fuel tank or portable dontainer 51 Row of stores
EMS-6 H2 Detector	4 Kerosene: fuel burning equipment or portable storage 53 Enclosed mall
HazMat-7 Required for Confined	Fires. 5 Diesel fuel/fuel oil: vehicle fuel tank or portable 58 Bus. & Residential
Wildland Fire-8 1 Detector alerted occ	upants 6 Household solvents: home/office spill, cleanup only 59 Office use
X Apparatus-9	7 Motor of 1. for protect or neutrino
Personnel-10 2 Detector did not ale	03 Military use
Arson-11 U Unknown	O Other: Special HarMat actions required or spill > 55gal., OO Other mixed use
C Oll our nown	Please complete the HazMat form
J Property Use* Structures	341 Clinic, clinic type infirmary 539 Household goods, sales, repairs
	342 Doctor/dentist office 579 Motor vehicle/boat sales/repair
131 Church, place of worship	361 Prison or jail, not juvenile 571 Gas or service station
161 Restaurant or cafeteria	419 X 1-or 2-family dwelling 599 Business office
162 Bar/Tavern or nightclub	429 Multi-family dwelling 615 Electric generating plant
213 Elementary school or kindergarten	439 Rooming/boarding house 629 Laboratory/science lab
215 High school or junior high	449 Commercial hotel or motel 700 Manufacturing plant
241 College, adult education	459 Residential, board and care 819 Livestock/poultry storage(barn)
311 Care facility for the aged	464 Dormitory/barracks 882 Non-residential parking garage
331 Hospital	519 Food and beverage sales 891 Warehouse
Outside	936 Vacant lot 981 Construction site
124 Playground or park	938 Graded/care for plot of land 984 Industrial plant yard
655 Crops or orchard	946 Lake, river, stream
669 Forest (timberland)	951 Railroad right of way Lookup and enter a Property Use code only if you have NOT checked a Property Use box:
807 Outdoor storage area	960 Other street Property Use 419
919 Dump or sanitary landfill	OCI Udebway/divided highway
931 Open land or field	OC2 Pegidential street/driveway I or 2 family dwelling
	NFIRS-1 Revision 03/11/99

A MM DD Y	YYY 2013	Station Incident No.		000 Exposure		NFIRS -2 Fire
B Property Details	_	C On-Site Material or Products Enter up to three codes.	ag Pr	ounts of ricultur	f there were any significommercial, industrial, al products or materials whether or not they because	energy or on the
B1 0001 Not Residential Estimated Number of residential living units in building of origin whether or not all units became involved		NNN None 2 3 4		2 Pr 3 Pa 4 Re	Bulk storage or warehousing Processing or manufacturing Packaged goods for sale Repair or service Bulk storage or warehousing	
B2 001 Buildings not invol	ved	On-site material (2)		2 Pr 3 Pa 4 Re	ocessing or manufactured codes for a spair or service	acturing sale
B3 X None Acres burned (outside fires) Less than one acre		On-site material (3)		2 Pr 3 Pa 4 Re	lk storage or ware cocessing or manufackaged goods for a epair or service	acturing
D Ignition	E ₁	Cause of Ignition Check box if this is an ex- Skip to section G	posure report.		Human Factors Contributing To Check all applicable	
D1 26 Laundry area, wash Area of fire origin * D2 12 Radiated, conducted	1 _	L Intentional Z X Unintentional B Failure of equipment or Act of nature Cause under investigation			1 Asleep 2 Possibly impairal cohol or dry 3 Unattended per 4 Possibly ments	igs son
D3 94 Dust, fiber, lint,	τ	· -	To Ignit	ion	5 Physically Dis	ons involved
Ttem first ignited * 1 Check Box if fire spread was confined to object of origin D4 Type of material first ignited Required only if item first ignited code is 00 or <70		Factor Contributing To Ignition Factor Contributing To Ignition Factor Contributing To Ignition	lean (1)	- 1	7 Age was a fact Estimated age of person envolved 1 Male	ror
F1 Equipment Involved In Ignition [None If Equipment was not involved, Skip to Section G [813 Washer/dryer Equipment Involved] Brand [Model]	11 Equip	Equipment Power Electrical	Ent	cer up	to three codes. n factor (1)	ors None
Serial #	moved be use	ble equipment normally can be by one person, is designed to in multiple locations, and des no tools to install.	e		n factor (3)	
None 1 Not involved in ignition, but burned 2 Involved in ignition, but did not burn 3 Involved in ignition and burned	oile prop	e Property Type & M	ake	Sor th fr Ar Po	I Use Pre-Fire Plan Av me of the information pr is report may be based to om other Agencies son report attache lice report attache croner report attache her reports attach	resented in apports and apport reports and apport reports and apport reports and apport report repor
Moblie property model License Plate Number State	VIN Numbe	Year			NFIRS-2 Revision	01/19/99

I1 Structure Type * If Fire was In enclosed building or a portable/mobile structure complete the rest of this form	I ₂ Building			Lght OOF as part	I4 Main Floor Size	NFIRS-3 Structure Fire
1 [X] Enclosed Building 2 Portable/mobile structure 3 Open structure 4 Air supported structure 5 Tent 6 Open platform (e.g. piers) 7 Underground structure (work areas) 8 Connective structure (e.g. fences) 0 Other type of structure	1 Under const: 2 X Occupied & d 3 Idle, not re 4 Under major 5 Vacant and to 6 Vacant and to 7 Being demol: 0 Other Undetermine	operating outinely used renovation secured unsecured	Total num	ber of stories by grade	OR Lenght in feet OT V V V V V V V V V V V V V	000 , 040 dth in feet
_ IIIC OLIGIN X	Damage Count the ROOF as p Number of ste (1 to 24% flat Number of ste (25 to 49% flat Number of ste (50 to 74% flat	ories w/ minor dame damage) ories w/ signifi lame damage) ories w/ heavy da lame damage) ories w/ extreme	e chest story amage cant damage	To Check OR Si OR UI K1 Item K2 Type of	ame as material first ignited nable to determine contributing most to flame spre	Skip To Section L
L1 Presence of Detectors * (In area of the fire) N X None Present	1 Batter 2 Hardwi 3 Plug i 4 Hardwi 5 Plug i 6 Mechan 7 Multpl power 0 Other U Undete 1 Fi c 2 Op (C 3 Fa	re only in ire with batte in with batte ical e detectors supplies	tion	Require 1 Alert 2 Occup 3 There 4 Faile U Undet L6 Det Require 1 Power 2 Impro 3 Defect 4 Lack 5 Batte	of maintenance, include ery missing or disconnec ery discharged or dead	responded on operate sconnect cement s cleaning
i . 💬	mplete rest F Section M ent System * med range of AES	System Required if fire 1 Operated 2 Operated 3 Fire tod 4 Failed t 0 Other U Undeterm M4 Number Heads O Required if	l & effect l & not ef o small to o operate nined of Sprink operating system op	designed rang	M4 1 System shut off 2 Not enough agent 3 Agent discharged not reach fire 4 Wrong type of sy 5 Fire not in area 6 System component 7 Lack of maintena 8 Manual Intervent 0 Other U Undetermined	Reason ailed discharged but did stem protected s damaged nce

K1 Person/Entity	Involved
incident location. Then skip the three duplicate address lines.	FLORENCE MATEDI Ms., Mrs. First Name MI Last Name Suffix Ms., Mrs. First Name Suffix Ms., Mrs. First Name MI Last Name Suffix Ms., Mrs. First
K2 Owner Same as pe	cson involved? this box and skip
The rest of Local Option Check this box if same address as incident location. Then skip the three duplicate address lines.	Ethis section. Business name (if Applicable) Area Code Phone Number JACOB MATEDI MATEDI Last Name Suffix 345 FARRINGTON Index Prefix Street or Highway Street Type Suffix Apt./Suite/Room City MN
ENGINE #4 ASSUMED CREW USED A HAND- SQUAD #1. SQUAD THE BASEMENT BUT	SPONDED TO A REPORT OF A DWELLING FIRE INSIDE THE WALK-OUT BASEMENT. COMMAND AND COMPLETED A 360 CHECK OF THE OUTSIDE OF THE HOME, WHILE THE LINE TO ATTACK THE FIRE IN THE BASEMENT AND COMPLETED A WATER SUPPLY TO #1 USED A HAND-LINE TO BACK-UP ENGINE #4 AND COMPLETED A PRIMARY SEARCH OF DID NOT FIND ANY VICTIMS. HAND-LINE OFF ENGINE #4 TO ATTACK THE FIRE ON THE FIRST FLOOR AND COMPLETED
ON THE FIRST FLOC	DID NOT FIND ANY VICTIMS. ENGINE #8 USED A HAND-LINE TO BACK-UP ENGINE #7 R AND CHECKED THE ATTIC BUT DID NOT FIND ANY FIRE EXTENSION. ENGINE #22 SUPPLY TO ENGINE #8 AND STOOD-BY AS SAFETY CREW.
ARRIVED TO TAKE C	THEIR LADDER TO THE ROOF AND CUT TWO LARGE HOLES FOR SMOKE VENTILATION. I VER DIVISION CHARLIE IN THE REAR OF THE HOUSE. LADDER #22 COMPLETED VERHAUL WITHIN THE BASEMENT IN THE REAR. SQUAD #3 STOOD-BY IN STAGING. IONS DOCTOR ON SCENE STOOD-BY FOR SAFETY BUT NO VICTIMS WERE FOUND.
ALL CLEAR OF SEAR	KROEGER INTERVIEWED THE OWNER AND OCCUPANTS OF THE HOME. I RECEIVED AN CHES AT 1408 HOURS AND A SAFETY CHECK WAS COMPLETED AT 1411 HOURS. FIRE AS INTERVIEWED BY THE MEDIA.
HELD A FIRE REVIEUNTIL RED CROSS A	ROSS FOR THREE ADULTS AND A BOARD-UP CREW FOR 16 WINDOWS AND 3 DOORS. I W BEHIND ENGINE #4 AND REQUESTED SAINT PAUL POLICE STAND-BY WITH OCCUPANTS RRIVED. OFFERED TO THE OWNER BUT HE STATED THE HOME WAS IN FORECLOSURE AND HAD NO
L Authorization	
1892 Officer in charge	JADWINSKI, STANLEY J 150 C3 11 23 2013 Signature Position or rank Assignment Month Day Year
Check Box if X 1892 same as Officer Member making repair charge.	JADWINSKI, STANLEY J 150 C3 11 23 2013 Out ID Signature Position or rank Assignment Month Day Year

Saint Paul Fire Department FIRE INCIDENT DISPOSITION



INCIDENT NUMBER:	13-34597	DATE OF INCIDE	NT: 11-23-2013		
TIME OF INCIDENT:	1348 hours	POLICE CASE #: N/A			
INVESTIGATOR (s):	Brian Kroeger				
INCIDENT ADDRESS:	1325 Arkwright Street, 55	106			
OCCUPANT NAME:	Florence Matedi PHONE: 850-212-8898				
OWNER NAME:	Jacob Matedi PHONE: 651-497-6060				
ADDRESS OF OWNER:	1345 Farrington Street, A	partment #109,	Saint Paul, MN 55117		
PROPERTY DAMAGED:	Single Family Dwelling	AREA OF ORIGIN	:Laundry Room		
DAMAGE ESTIMATE:	Building \$100,000	Vehicle \$	Other (Describe) \$		
VALUE:	Building \$113,700	Vehicle \$	Other (Describe) \$		
Damage Estimate CONTENTS ONLY:	\$ 50,000				
INJURY/DEATH (if yes, explain)	No ☐ Yes				
SMOKE DETECTOR/ SPRINKLER INFORMATION:	Smoke Detector Present:				
FIRE CAUSE CLASSIFICATION:	Accidental Incendiary Child (under 10 years old) Natural Undetermined Under Investigation				
SYNOPSIS:	The Fire Department was called to a report of a dwelling fire. On arrival, Engine #4 found a house with a walkout basement fully involved in fire. Crews extinguished the fire and performed ventilation and overhaul. All occupants had self-evacuated. The house sustained substantial fire damage. The resident reports starting the dryer and going to take a shower. Her daughter came home, smelled smoke, saw a fire in the laundry room, and alterted the other people in the house. Based on fire patterns and interviews, it is my opinion the fire began behind the dryer near the vent. The first material ignited was dryer lint or clothes. The ignition source was heat from the dryer. Lack of dryer maintenance brought these items together. The classification of fire cause is accidental.				
DISPOSITION:	E-mail only DO NOT DEMOLISH until approved Analysis of Evidence Pending Hold Scene until approved Scene Released Report to Follow				

FIRE INVESTIGATION REPORT

INCIDENT NO: 13-34597

DATE: 11/23/2013

TIME: 1348 HOURS

ADDRESS: 1325 ARKWRIGHT ST

INSURANCE CO: NONE

DAMAGE ESTIMATE: \$150,000

SYNOPSIS: On Saturday, November 23, 2013, at 1348 hours, the Saint Paul Fire Department responded to a report of a single-family dwelling fire. The location of the incident was 1325 Arkwright Street. On arrival, Engine #4 found a house with a walk-out basement fully involved in fire. Crews extinguished the fire and performed ventilation and overhaul. All occupants had self-evacuated. Based on fire patterns and interviews, it is my opinion the fire began behind the dryer near the vent. The first material ignited was dryer lint or clothes. The ignition source was heat from the dryer. Lack of dryer maintenance brought these factors together. The classification of fire cause is accidental.

PEOPLE: Property Owner, JACOB M. MATEDI, 1345 Farrington Street, 55117, 651-497-6060, DOB 06/19/1952.

Occupant, FLORENCE H. MATEDI, 1325 Arkwright Street, 55130, 850-212-8898, DOB 07/13/1957.

Occupant, TATA MATEDI, 1325 Arkwright Street, 55130, 850-212-8898, DOB 06/23/1987.

Occupant, IMMANUEL MATEDI, 1325 Arkwright Street, 55130, 850-212-8898, DOB 04/15/1991.

BACKGROUND: I received notification of the fire via the Communications Center at 1348 hours. I responded to the incident scene and arrived at approximately 1355 hours. The weather conditions were clear skies with calm winds, and the outside temperature was approximately 20° Fahrenheit. Fire extinguishment was in progress with active fire conditions at the time of my arrival. Substantial overhaul was performed due to the extent of fire damage.

PROPERTY DESCRIPTION: The structure is a one story, wood framed, single family dwelling with a walk-out basement underneath a deck on side "C." The building measures approximately 25 feet deep by 40 feet wide. The address side faces east. There is a small two-car garage off the B/C corner, which was not damaged in the fire.

EXTERIOR EXAMINATION: Visual inspection of the exterior found that the windows had all been broken out during firefighting operations. There were a number of items surrounding the structure; a chest freezer, piano, window air conditioning units, etc., particularly on side B and to some degree on side C. The eaves and upper portions of the exterior walls had some

Fire Investigation Report 1325 Arkwright Street Page Two

charring due to fire and smoke damage. Crews had ventilated the roof above the living room with an approximately 4 foot by 4 foot hole.

INTERIOR EXAMINATION: Visual inspection of the interior noted heavy fire and smoke damage throughout. The first floor of the structure contains a living room, a kitchen/dining room area, a bathroom, and three bedrooms. The dining room has sliding doors that open onto the deck on side C. The bedroom in the A/B corner had smoke damage. The door to that room was closed and locked and was forced during firefighting operations. The bedroom in the B/C corner had suffered heavier smoke damage. The bedroom facing side A and the bathroom, facing side C, had heavy smoke damage, extending down to the floor in each case.

The hallway, kitchen, dining room, and living room all had very heavy fire and smoke damage, with contents, cabinetry, walls, and ceilings being extensively damaged or destroyed. The hollow-core door to the basement was burned through at the top with fire impingement from the basement side.

The basement level is a full walk-out with sliding doors on the C side underneath a deck. The D side of the basement contained a family room. That room had miscellaneous items in it, including a sofa sleeper and exercise equipment. The family room received heavy fire and smoke damage. The circuit breaker panel for the structure was in this room on the A side wall. A number of the breakers were tripped but there was no identification for circuits. There was a space heater near the sofa sleeper which did not appear to be plugged into an outlet. There was a wall-mounted electric heater in the family room on side C of the house. The room received significant smoke and fire damage, extending down to approximately two feet from the floor in most of the room. The family room has a hallway towards the C side that leads to a bathroom facing the C side and a bedroom on the B/C corner. The bathroom had suffered heavy smoke damage. The basement bedroom had suffered lighter smoke damage. The fire had begun to burn through the back of the bedroom closet that abuts the laundry room.

There are a set of center stairs with the basement landing in the center of the A side. The stairs and stairwell were heavily charred throughout.

The A/B corner of the basement contains a laundry room as well as the furnace and water heater. The ductwork for the furnace and water heater was distorted by exposure to fire conditions. Neither appliance appeared to be the origin of the fire.

Wall studs throughout the entire room were heavily charred. The washer was below a small window on the B side, and fire crews reported that there was a chest freezer on the outside of the house placed up against this window. The washer was plugged in and empty. The plug was melted from the heat of the fire but no arcing or shorting was evident. The gas dryer was against the A side wall next to the washer. It was placed on a solid pallet with fire damage to the center-

Fire Investigation Report 1325 Arkwright Street Page Three

rear of the pallet near the vent exhaust. The gas line to the dryer was intact. The dryer contained a small amount of charred clothing. The lint screen was present. The dryer originally appeared to have been vented with a plastic vent hose which melted during the fire. Remnants of the vent hose wire coil were found behind the dryer.

<u>INTERVIEWS</u>: Occupant, FLORENCE H. MATEDI, was interviewed on Saturday, November 23, 2013, at the scene and stated:

- She was doing laundry and had put some clothes in the dryer when she went upstairs to take a shower.
- Her daughter came in and told her there was a fire.
- She evacuated the structure with her daughter at that time.
- There is a door to the laundry room at the bottom of the stairs and it is normally closed.
- She cannot recall any problems with the appliances or electrical system.
- No one smokes in the house.
- The house has been in foreclosure for some time and she does not have insurance.
- She has lived there for approximately 16 years.
- She lives with her daughter, TATA, and her son, IMMANUEL, who is not at home today, and two other adults who are renting rooms.

Occupant, TATA MATEDI, was interviewed on Saturday, November 23, 2013, at the scene and stated:

- She came home and smelled smoke.
- She went downstairs and found the door to the laundry room was partially closed.
- Looking in the laundry room, she saw flames in the corner, behind the dryer.
- She went upstairs and alerted her mother and they evacuated the structure.
- She called 9-1-1 to report the fire.

Fire Investigation Report 1325 Arkwright Street Page Four

Property Owner, JACOB M. MATEDI, was interviewed on Saturday, November 23, 2013, over the telephone and stated:

- They purchased the house in November of 1999.
- They have been behind in the payments for some time and the house has been in foreclosure for "several years."
- They filed for bankruptcy several months ago.
- They do not have insurance.

PHOTOGRAPHS/SKETCH: Digital photographs were taken and a sketch will be provided.

EVIDENCE: No evidence was collected.


CONCLUSION: After examination of the fire scene and the interviews conducted with the residents, it is my opinion the fire began in the vent exhaust of the dryer or in the clothes in the dryer. The fire appears to have spread through the laundry room, then into the stairwell and family room, then burned through the door at the top of the stairs and travelled into the kitchen/dining room/living room areas. The first material ignited was dryer lint or possibly clothes. The ignition source was heat from the dryer. Lack of dryer maintenance brought these factors together. The classification of fire cause is accidental. This concludes my investigation and report.

B. Kroeger, Fire Investigator, C Shift, November 27, 2013

Bris Morey

BK/su

Plan of First Floor 1325 Arkwright

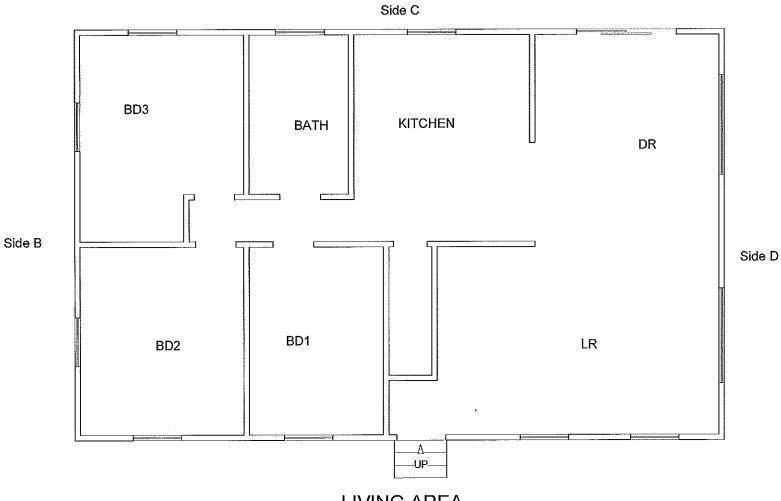


LIVING AREA 1021 sq ft

Side A

Plan Basement 1325 Arkwright

Side C

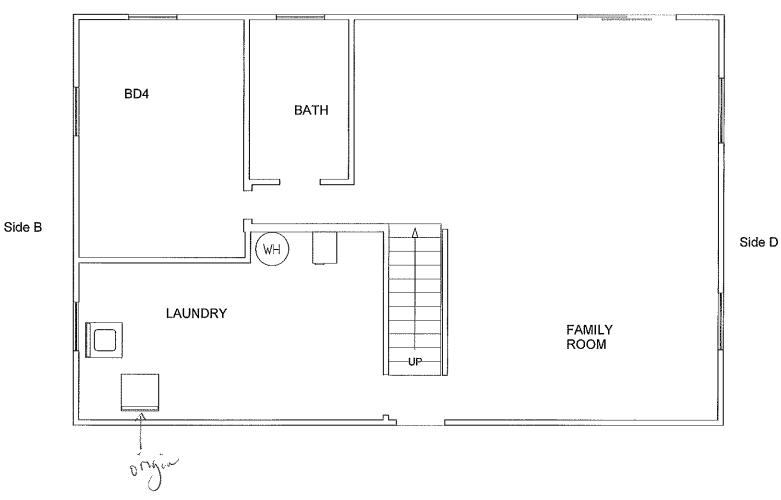

Side A