RLH FCO 20-53



APPLICATION FOR APPEAL

Saint Paul City Council - Legislative Hearings RECEIVED 310 City Hall, 15 W. Kellogg Blvd.

	KLOLIVLD	Saint Paul, Minnesota 55102
1854	JUN 08 2020	Telephone: (651) 266-8585
We need the following to process your appeal:	CITY CLERK	
\$25 filing fee (non-refundable) (payable to the C (if cash: receipt number) (provided Tuesday,	G DATE & TIME by Legislative Hearing Office) JUNE 16, 2020 1:30 p.m
O Walk-In OR Mail-In		of Hearing:
for abatement orders only: O Email OR		City Hall/Courthouse
Address Being Appealed:	1:30	ell between .m. 4 21.30 p.m.
Number & Street: 777 6th St E	city: St Paul	_ State: <u>MN</u> Zip: <u>55106</u>
Appellant/Applicant: RUBYNGUTEN/HAI	UK CU Email cat	\$5 rat a quail. com
Phone Numbers: Business R Signature:		
Mailing Address if Not Appellant's: 119 ER	iver Rd MPLS	MN 55414
Phone Numbers: Business Re	sidence	_ Cell
) Fire C of O Deficiency List/Correction Code Enforcement Correction Notice) Vacant Building Registration	reinspection on the correct the	tate is too close s. need more dim tems.

Ricardo X. Cervantes, Director

SAINT PAUL CITY OF SAINT PAUL

375 Jackson Street, Suite 220 St Paul, Minnesota 55101-1806

 Telephone:
 651-266-8989

 Facsimile:
 651-266-9124

 Web:
 www.stpaul.gov/dsi

May 27, 2020

Hank T Cu 1119 E River Pkwy Minneapolis MN 55414-3106

RE: RE-INSPECTION FIRE CERTIFICATE OF OCCUPANCY WITH DEFICIENCIES 777 6TH ST E

Ref. # 115063

Dear Property Representative:

Your building was re-inspected for the Fire Certificate of Occupancy on May 27, 2020. Approval for occupancy will be granted upon compliance with the following deficiency list. The items on the list must be corrected immediately.

A reinspection will be made on June 11, 2020 at 1:50 PM.

Failure to comply may result in a criminal citation or the revocation of the Fire Certificate of Occupancy. The Saint Paul Legislative Code requires that no building be occupied without a Fire Certificate of Occupancy. The code also provides for the assessment of additional reinspection fees.

DEFICIENCY LIST

- 1. Access SPLC 34.19 Provide access to the inspector to all areas of the building.
- 2. Exterior Back Stairs SPLC 34.09 (3), 34.33(2) Repair or replace the unsafe stairways, porch, decks or railings in an approved manner. This work may require a permit(s). Call DSI at (651) 266-8989. The back-entry stairs are in disrepair and are unsafe to use. The stringers are cracked and damaged. The area under the back stairs has members and components that are part of the stairs that is rotted, damaged and broken. Bring the stairs up to code. The stairs are loose and unsecured. A permit is required for this work.
- 3. Exterior Back Yard SPLC 34.08 (1), 34.32 (1) All exterior property areas shall be maintained free from any accumulation of refuse, garbage or feces. -Dispose of all unused, junk material in the back yard. Also, remove the items next to the gas meters.

- 4. Exterior Back Yard SPLC 34.08 (3) Provide and maintain suitable ground cover on all exterior areas to control erosion. -The entire back yard is dirt.
- 5. Exterior Building SPLC 34.09 (1)(2), 34.33 (1) Provide and maintain all exterior walls free from holes and deterioration. All wood exterior unprotected surfaces must be painted or protected from the elements and maintained in a professional manner free from chipped or peeling paint. -All around the house, there are various spots that have multiple damages. There is peeling paint, holes in boards, holes in soffits, holes in fascia, rotted boards, discolored and unprotected surfaces, broken wood panels.
- 6. Exterior Electrical Fixtures MSFC 605.1 Repair or replace damaged electrical fixtures. This work may require a permit(s). Call DSI at (651) 266-8989.-Near the electric meter, there is a section of the conduit for the wires that is broken and is now exposing the wires going into the house. Contact a licensed contractor to do this repair. A permit is required. DO NOT CALL XCEL ENERGY as this section of the wiring does not belong to them.
 - There is an outlet box on the East (right) side of the house that is missing the covers over the outlets.
- 7. Exterior Fence SPLC 34.08(5), 34.32(3) All accessory structures including, but not limited to, detached garages, sheds and fences shall be maintained structurally sound and in good repair. Provide and maintain exterior unprotected surfaces painted or protected from the elements. -The fence on the West side of the building is in disrepair and has sections that have broken off and is leaning.
- 8. Exterior Front Storm Door SPLC 34.33 (3) Repair and maintain the door in good condition. -The front entry storm door is missing the screen.
- 9. Exterior Front of Building SPLC 34.08 (10) Repair, replace and maintain exterior sidewalks, walkways and stairs.
 - The front steps are cracked and damaged and there is a section of the wooden retaining wall that is damaged and has nails sticking out. The concrete section near the handrail is damaged.
 - There is a section of the concrete retaining wall that is damaged.
- 10. Exterior Front of Building MSFC 505.1 The address posted is not visible from street. -The address numbers do not contrast against its background.
- 11. Exterior Front of Building SPLC 34.09 (3), 34.33(2) Repair or replace the damaged handrail in an approved manner. This work may require a permit(s). Call DSI at (651) 266-8989.-The front handrail is broken at the bottom.
- 12. Exterior Parking Surface SPLC 34.08 (7) All parking spaces shall be paved with asphalt, concrete, or durable dustless surfacing. Before any existing spaces may be paved, site plan approval must be obtained as specified in the St. Paul Zoning Code. Contact DSI Zoning at 651-266-8989.-The parking surface is no longer maintained and the asphalt surface is damaged.

- 13. Exterior Window Screens SPLC 34.09 (4), 34.33 (3) -Provide or repair and maintain the window screen. -There are window screens that are missing, torn and damaged.
- 14. Exterior Windows SPLC 34.09 (4), 34.33 (3) Repair and maintain the window in good condition.
 There are several windows that have chipping and peeling paint on the frame and sills, There is a porch window completely missing.
- 15. Interior Back Entry Door SPLC 34.33 (3) Repair and maintain the door in good condition. -The back-entry door has a screw sticking out near the metal plate. The overhead door closer is missing.
- 16. Interior Back Stairway SPLC 34.09 (4), 34.33 (3) Repair and maintain the window in good condition. -The window in the back stairway does not latch and close. This window must be able to latch for security purposes. There is also chipping and peeling paint on the frame and sill.
- 17. Interior Basement MSFC 1008.1.9.3 Remove unapproved locks from the exit doors. The door must be openable from the inside without the use of keys or special knowledge or effort. -There is an unapproved lock on the door leading to the mechanical room.
- 18. Interior Basement MFGC 404.15 Provide leak tight caps or plugs on disconnected or unused gas lines. -There is a gas line near the laundry machine that is not capped-off.
- 19. Interior Basement MMC 504.6 Provide, repair or replace the dryer exhaust duct. Exhaust ducts for domestic clothes dryers shall be constructed of metal and shall have a smooth interior finish. The exhaust duct shall be a minimum nominal size of four inches (102 mm) in diameter and installed in accordance with the mechanical code. This work may require a permit(s). Call DSI at (651) 266-8989.-The dryer exhaust duct has been improperly installed and is disconnected at the very top.
- 20. Interior Basement MMC 607 Repair, replace or install duct work in compliance with the mechanical code. This work may require a permit(s). Call DSI at (651) 266-8989.— There is a section of the warm-air duct (near laundry machines) that is sagging and is not properly secured to the joist. Properly secure the warm-air duct.
- 21. Interior Basement MPC 507.5 Provide pressure relief valve for hot water heater piped to within 18 inches of the floor.
 The drain relief pipe for the gas-powered water heater has the incorrect type of pipe.
 The drain relief pipe for the electric water heater is too short.
- 22. Interior Basement SPLC 34.19 Provide access to the inspector to all areas of the building. -There is a metal door that is locked. Provide access to this area.
- 23. Interior Basement Stairs SPLC 34.10 (3) 34.34(2) Provide an approved guardrail. Intermediate balustrade must not be more than 6 inches apart. Intermediate rails must be provided if the height of the platform is more than 30 inches.

- 24. Interior Basement Stairs SPLC 34.10 (3), 34.34(2) Repair or replace the damaged handrail in an approved manner.
- 25. Interior Ceilings SPLC 34.10 (7), 34.17 (5) Repair and maintain the ceiling in an approved manner.

The ceiling in the front stairway has chipping and peeling paint.

There is a peeling paint on the back-entry ceiling.

There are damages on the basement stairway ceiling.

- 26. Interior Front Porch Area MSFC 315.3 Provide and maintain orderly storage of materials.
- 27. Interior Front Porch Area MN Stat 299F.18 Immediately remove and discontinue excessive accumulation of combustible materials.
- 28. Interior Light Fixture SPLC 34.12 (2), SPLC 34.36 (1) Repair and maintain all required and supplied equipment in an operative and safe condition to properly and safely perform their intended function in accordance with the provisions of the applicable code. The light fixture in the back stairway is missing the cover/globe.
- 29. Interior Walls SPLC 34.10 (7), 34.17 (5) Repair and maintain the walls in an approved manner.

The walls in the basement stairway are damaged and has very large cracks. The walls in the front stairway has chipping and peeling paint.

- 30. Interior Water Meter Area MPC 312, 313 Provide approved support for all plumbing piping. -The water lines nearest to the water meter are not properly secured.
- 31. Unit 1 Bathroom SPLC 34.11 (1), MSBC 2902.1, SPLC 34.35 (1), MPC 301.1 Repair or replace and maintain all parts of the plumbing system to an operational condition.

The bath tub faucet is leaking and the cover for the drain overflow is missing. The toilet is loose and unsecured.

- 32. Unit 1 Bathroom & Kitchen SPLC 34.10 (7) Repair and maintain the cabinets in an approved manner. -There are cabinets that are missing the glass and one of the bathroom drawers is damaged.
- 33. Unit 1 Bedroom & Front Room SPLC 34.23, MSFC 110.1 This occupancy is condemned as unsafe or dangerous. This occupancy must not be used until re-inspected and approved by this office.

The front room in apartment 1 has been condemned because it is not a legal bedroom. The windows in this room do not meet the size requirements for egress windows and the windows open into an enclosed porch with furniture and other materials blocking the windows.

The back-bedroom window in apartment 1 has been condemned because the (only) window in this room is covered by heavy plastic and the glass is broken with sharp, pointy edges. This window is unsafe to be use.

- 34. Unit 1 Ceilings SPLC 34.10 (7), 34.17 (5) Repair and maintain the ceiling in an approved manner. -There are ceilings with unfinished repairs on them and the surface for the bathroom ceiling is peeling.
- 35. Unit 1 Doors SPLC 34.33 (3) Repair and maintain the door in good condition. The door stop for the bedroom door is broken and the door rubs against the carpet. The door knob and latch for the front room door is in disrepair.

 The mortise lock and latch for the front entry door is damaged.

 The door in the living room area has a missing wood panel.

 The bathroom door knob is loose.
- 36. Unit 1 Floor SPLC 34.10 (7), 34.17(5) Repair and maintain the floor in an approved manner. -There is a section of the living room floor that is damaged.
- 37. Unit 1 Front Room MSFC 1030.1 Provide and maintain an approved escape window from each sleeping room or area or discontinue use of area as a sleeping room. This work may require permit(s). Call DSI at (651) 266-8989.-The front room in apartment 1 has been condemned because it is not a legal bedroom. The windows in this room do not meet the size requirements for egress windows and the windows open into an enclosed porch with furniture and other materials blocking the windows.
- 38. Unit 1 Kitchen SPLC 34.10 (7), 34.17 (5) Repair or replace and maintain the woodwork in an approved manner. -There is a section of the baseboard molding that is missing. The wooden molding is leaning against the kitchen wall.
- 39. Unit 1 Kitchen Area MSFC 308.1.2 No person shall throw or place, or cause to be thrown or placed, a lighted match, cigar, cigarette, matches, or other flaming or glowing substance or object on any surface or article where it can cause an unwanted fire.-There is a used incense candle near the back entry door. Discontinue burning incense candles incorrectly.
- 40. Unit 1 Light Fixtures SPLC 34.12 (2), SPLC 34.36 (1) Repair and maintain all required and supplied equipment in an operative and safe condition to properly and safely perform their intended function in accordance with the provisions of the applicable code. There are light fixtures that are missing the cover/globe.
- 41. Unit 1 Smoke Alarms MN Stat. 299F.362 Immediately provide and maintain a smoke detector located outside each sleeping area.

 The hard-wired smoke alarm in the front area has come loose from the wall.

 The hard-wired smoke alarm in the living room is not working.

 The battery powered smoke alarm in the bedroom is missing.
- 42. Unit 1 Walls SPLC 34.10 (7), 34.17 (5) Repair and maintain the walls in an approved manner. -There are walls with unfinished repairs.

43. Unit 1 - Windows - SPLC 34.09 (4), 34.33 (3) - Repair and maintain the window in good condition.

The window in the back bedroom has plastic covers over it and the glass is broken. The living room window has a broken latch.

- 44. Unit 2 Door SPLC 34.33 (3) Repair and maintain the door in good condition. -Repair the door handle for the front bedroom door. A portion of the door frame is damaged and there is no slot for the latch and the strike plate is missing.
- 45. Unit 2 Front Bedroom SPLC 34.12 (2), SPLC 34.36 (1) Repair and maintain all required and supplied equipment in an operative and safe condition to properly and safely perform their intended function in accordance with the provisions of the applicable code. The heat register in the front right bedroom is coming loose from the wall.
- 46. Unit 2 Smoke Alarms MN Stat. 299F.362 Immediately provide and maintain a smoke detector located outside each sleeping area. -The smoke alarms in the front two (2) bedrooms are missing.
- 47. Unit 2 Windows SPLC 34.09 (4), 34.33 (3) Repair and maintain the window in good condition.

The windows in the front bedroom have lots of chipping and peeling paint, a window is missing a latch, a section of the bottom sash that is damaged and there are windows that are unable to stay open. Windows must be able to stay open at all points.

There is storm window that has come out of its track.

The window in the back bedroom does not close properly and the crank handle case is loose and unsecured.

Saint Paul Legislative Code authorizes this inspection and collection of inspection fees. For forms, fee schedule, inspection handouts, or information on some of the violations contained in this report, please visit our web page at: http://www.stpaul.gov/cofo

You have the right to appeal these orders to the Legislative Hearing Officer. Applications for appeals may be obtained at the Office of the City Clerk, 310 City Hall, City/County Courthouse, 15 W Kellogg Blvd, Saint Paul MN 55102 Phone: (651-266-8585) and must be filed within 10 days of the date of the original orders.

If you have any questions, email me at Efrayn.Franquiz@ci.stpaul.mn.us or call me at 651-266-8955 between 7:30 a.m. - 9:00 a.m. Please help to make Saint Paul a safer place in which to live and work.

Sincerely,

Efrayn Franquiz Fire Safety Inspector Ref. # 115063