

CITY OF SAINT PAUL

COMMERCE BUILDING 8 Fourth St. E, Suite 200 Saint Paul, Minnesota 55101-1024 Telephone: 651-266-9090 Facsimile: 651-266-9099 Web: www.ci.stpaul.mn.us/liep

June 27, 2005

Randy C. Kelly, Mayor

ERNEST B TROWER 2075 SCUDDER ST ST PAUL MN 55108-1822

**Re:** 2075 Scudder St File #: 04 128950 VB2

## Dear Property Owner:

Pursuant to your request the above-referenced property was inspected and the following report is submitted:

#### BUILDING

- 1. Install landing and steps on side entry.
- 2. Install guardrails and handrails to code in basement
- 3. Install tempered glass in both stairway windows
- 4. Install 20 minute fire rated door between house and garage.
- 5. Install handrail to code on front steps.
- 6. Repair garage door.
- 7. Repair roof as needed and have it inspected.
- 8. Repair walls and ceilings throughout, as necessary.
- 9. Tuck Point interior/exterior foundation.
- 10. Repair soffit, fascia trim, etc. as necessary.
- 11. Provide hand and guard rails on all stairways and steps as per attachment.
- 12. Provide thumb type dead bolts for all entry doors. Remove any surface bolts.
- 13. Repair or replace any deteriorated window sash, broken glass, sash holders, re-putty etc. as necessary.
- 14. Provide storms and screens complete and in good repair for all door and window openings.
- 15. Prepare and paint interior and exterior as necessary (take the necessary precautions if lead base paint is present).
- 16. Provide general clean-up of premise.
- 17. Provide smoke detectors as per the Minnesota State Building Code.
- 18. Provide general rehabilitation of front porch and steps.

**ERNEST B TROWER** 

## **ELECTRICAL**

- 1. Provide ground rod and insure bonded to water and water meter jumper.
- 2. Provide GFCI receptacle in bathroom and ground light.
- 3. Check all 3-wire outlets for proper polarity and ground.
- 4. Throughout building, install outlets and fixtures as per Bulletin 80-1.
- 5. Outside provide side door entry light.
- 6. Install smoke detectors as per Bulletin 80-1 and UBC.
- 7. Insure all circuits have proper over-current protection.
- 8. Remove or replace open-lamp lights in closet.

## **PLUMBING**

- 1. Water heater gas venting and water piping are incorrect. It also is not fired or in service.
- 2. Water meter has incorrect piping.
- 3. Repair or replace all corroded, broken or leaking water piping.
- 4. Water pipe sizing is incorrect.
- 5. Dryer gas connector is incorrect.
- 6. Soil and waste piping has no soil stack base clean-out.
- 7. Remove threads at faucet in laundry tub.
- 8. Kitchen sink is incorrectly vented.
- 9. Range gas connector is incorrect.
- 10. Bathtub is incorrectly vented.
- 11. Outside lawn hydrant requires back-flow assembly or device.
- 12. Plumbing vents have no flashing.

### **HEATING**

- 1. <u>Recommend</u> installing approved lever handle manual gas shutoff valve on furnace.
- 2. Clean and Orsat furnace burner. Check all controls for proper operation. Submit report.
- 3. Check furnace heat exchanger for leaks, provide documentation.
- 4. Tie furnace and water heater venting into chimney liner.

### ZONING

1. This property was inspected as being a single family residence.

ERNEST B TROWER 2075 SCUDDER ST 6/28/05 - Page 3

# **NOTES**

See attachment for permit requirements and appeals procedure.

- 1. Most of the roof covering could not be properly inspected from grade. Recommend this be done before rehabilitation is attempted.
- 2. There was considerable storage/clutter within property at the time of the inspection. All to meet appropriate Codes when complete.
- 3. All items noted as <u>recommended</u> do not have to be completed for code compliance but should be completed at a later date. Possible purchasers of property shall be made aware of these items.

Sincerely,

James L. Seeger Code Compliance Officer

JLS:ld

Attachments