DEPARTMENT OF SAFETY & INSPECTIONS (DSI) ANGIE WIESE, PE(MN), CBO, DIRECTOR



375 Jackson Street, Suite 220 Saint Paul, MN 55101-1806 Tel: 651-266-8989 | Fax: 651-266-9124

February 29, 2024

MIDWAY HOSPITALITY INC/SURESH BHAKTA 901 SNELLING AVE N ST PAUL MN 55104

RE: RE-INSPECTION FIRE CERTIFICATE OF OCCUPANCY WITH DEFICIENCIES 901 SNELLING AVE N

Ref. # 14437

Dear Property Representative:

Your building was re-inspected for the Fire Certificate of Occupancy on February 29, 2024. Approval for occupancy will be granted upon compliance with the following deficiency list. The items on the list must be corrected immediately. **A reinspection will be made on March 19, 2024 at 12:00 PM.**

Failure to comply may result in a criminal citation or the revocation of the Fire Certificate of Occupancy. The Saint Paul Legislative Code requires that no building be occupied without a Fire Certificate of Occupancy. The code also provides for the assessment of additional reinspection fees.

DEFICIENCY LIST

- 1. #11 Electrical service SPLC 34.14 (2)(A), 34.34 (5)(A) Provide an approved electrical service adequate to meet the building's needs. This work may require a permit(s), call DSI at (651) 266-8989.-On 11/6/23 inspection the unit was found to be without power.
- 2. #12 Bathroom MSFC 604.6 Provide electrical cover plates to all outlets, switches and junction boxes where missing.-Missing outlet cover.
- 3. #12 Bathroom SPLC 34.12 (2), SPLC 34.36 (1) Repair and maintain all required and supplied equipment in an operative and safe condition to properly and safely perform their intended function in accordance with the provisions of the applicable code.-Missing bathroom vent fan cover.
- 4. #12 Bathroom SPLC 34.11 (1), MSBC 2902.1, SPLC 34.35 (1), MPC 301.1 Repair or replace and maintain all parts of the plumbing system to an operational condition.-The hand sink was loose and falling from the counter top.

- 5. #12 Smoke alarm MN Stat. 299F.362, MSFC 1103.8 Immediately provide and maintain a smoke alarm located outside each sleeping area.-The smoke alarm was not operating, and was repaired at inspection.
- 6. #14 Bathroom NEC 406.4(D)(3) GFCI outlets shall be provided where replacements are made at outlets that are required to be so protected elsewhere in this Code.-The GFI in the bathroom did not have power at inspection.
- 7. #16 By air conditioner MSFC 604.6 Provide electrical cover plates to all outlets, switches and junction boxes where missing.-Missing outlet cover.
- 8. #17 Missing baseboard trim SPLC 34.10 (7), 34.17 (5) Repair or replace and maintain the woodwork in an approved manner.
- 9. #19 Bathroom MSFC 604.1 Repair or replace damaged electrical fixtures. This work may require a permit(s). Call DSI at (651) 266-8989.-The outlet is loose in the wall.
- 10. #20 Bathroom SPLC 34.10 (7), 34.17 (5) Repair and maintain the walls in an approved manner.-There is a hole in the wall under the bathroom sink.
- 11. #22 Bathroom MPC 4714.0100, MPC 1401.1 Provide approved plumbing materials for water, waste, and vent.-Flex pipe under bathroom sink.
- 12. #23 Bathroom MSFC 604.1 Repair or replace damaged electrical fixtures. This work may require a permit(s). Call DSI at (651) 266-8989.-The outlet is loose in the wall.
- 13. #23 Entry SPLC 34.10 (7), 34.17(5) Repair and maintain the floor in an approved manner.-Missing transition strip on flooring.
- 14. #31 Bathroom MSFC 604.1 Repair or replace damaged electrical fixtures. This work may require a permit(s). Call DSI at (651) 266-8989.-The outlet is loose in the wall.
- 15. #31 Bathroom NEC 406.4(D)(3) GFCI outlets shall be provided where replacements are made at outlets that are required to be so protected elsewhere in this Code.-GFI had no power at inspection.
- 16. #33 Bathroom MSFC 604.1 Repair or replace damaged electrical fixtures. This work may require a permit(s). Call DSI at (651) 266-8989.-The light switch was loose and partially hanging out of the wall.
- 17. #35 Bathroom MSFC 604.6 Provide all openings in junction boxes to be sealed.-Missing junction box cover.
- 18. #35 Bathroom SPLC 34.10 (7), 34.17 (5) Repair and maintain the ceiling in an approved manner.
- 19. #35 Missing baseboard trim SPLC 34.10 (7), 34.17 (5) Repair or replace and maintain the woodwork in an approved manner.

- 20. Allow access Required SPLC 34.19 Provide access to the inspector to all areas of the building.-On the 11/6/23 inspection several units denied access for the inspection. Cleaning person also stated that they did not have keys to the basement area. All occupants shall be made aware of inspection, and keys to all areas of the building shall be available for next inspection.
- 21. Basement Boiler room MSFC 704.1, 1105.1 Provide and maintain fire rated floor and/or ceiling construction with approved materials and methods. This work may require a permit(s). Call DSI at (651) 266-8989.-Holes in ceiling.
- 22. Basement Electrical work 2020 MSBC Chapter 1300.0120 Permits. Subpart 1. Required. An owner or authorized agent who intends to construct, enlarge, alter, repair, move, demolish, or change the occupancy of a building or structure, or to erect, install, enlarge, alter, repair, remove, convert, or replace any gas, mechanical, electrical, plumbing system, or other equipment, the installation of which is regulated by the code; or cause any such work to be done, shall first make application to the building official and obtain the required permit. -There have been new electrical panels and conduit run in the basement. There is no permit for this work. Hire a licensed electrician to pull a permit and have the new electrical work inspected and approved.
- 23. Basement Storage room MSFC 313.1 Fueled equipment, including but not limited to motorcycles, mopeds, lawn-care equipment and portable cooking equipment, shall not be stored, operator or repaired within a building.-20 pound propane cylinder was found in the basement. Propane cylinder was removed during inspection.
- 24. Boiler Not operational MMC 1346.0103 Mechanical systems, both existing and new, and parts of those systems, shall be maintained in proper operating condition in accordance with the original design and in a safe and sanitary condition. Devices or safeguards which are required by this code shall be maintained in compliance with the code edition under which they were installed.-Per conversation with manager on site, the boiler system is no longer operational. Have the non operational boiler removed, or properly abandoned in place by a qualified contractor.
- 25. Bollards By stairs to second floor MSFC 312.2 Vehicle impact protection posts. Guard posts shall comply with the following: 1. Constructed of steel not less than 4 inches in diameter and concrete filled; 2. Spaced not more than 4 feet between posts on center; 3. Set not less than 3 feet deep in a concrete footing of not less than a 15-inch diameter; 4. Set with the top of the posts not less than 3 feet above ground; 5. Located not less than 3 feet from protected object.-The bollards protecting the stairs to the second floor are loose, and only secured to the sidewalk by 2 bolts.
- 26. By ice machine Missing junction box cover MSFC 604.6 Provide all openings in junction boxes to be sealed.
- 27. Exterior Caretaker Residence MSFC 603.6 Have the chimneys, fireplaces, and vents inspected for soundness, freedom from deposits, and correct clearances. Cleaning, maintenance, and repairs shall be done if indicated by the inspection.-Both chimneys on the residence are deteriorating and in need of repair.

- 28. Exterior Screens as needed SPLC 34.09 (4), 34.33 (3) -All screens shall be maintained in a professional state of maintenance and repair.-Multiple missing, torn, and damaged screens throughout the property.
- 29. Interior Multiple units of Motel MSBC Chapter 1300.0120 Permits. Subpart 1. Required. An owner or authorized agent who intends to construct, enlarge, alter, repair, move, demolish, or change the occupancy of a building or structure, or to erect, install, enlarge, alter, repair, remove, convert, or replace any gas, mechanical, electrical, plumbing system, or other equipment, the installation of which is regulated by the code; or cause any such work to be done, shall first make application to the building official and obtain the required permit.-New heat/air conditioning units installed in each of the units when boiler failed. Contact contractor and inform them of the requirement to install the heating units under mechanical permit and electrical permit. No permits with the city were obtained by contractor for this work. If the original contractor cannot be contacted, then a new contractor must be contacted/contracted for the installation, must obtain permits for the work and contact city inspectors to review the work and finalize the permits. Inspection of the work to be done by city mechanical and electrical trades inspectors for compliance and permits finalized.
- 30. Midway Motel Emergency Plans and Employee Training MSFC Employee Training and Response Procedures 406.2 Frequency. Employees shall receive training in the contents of fire safety and evacuation plans and their duties as part of new employee orientation and not less than annually thereafter. Records of training shall be maintained. 406.3 Employee training program. Employees shall be trained in fire prevention, evacuation and fire safety in accordance with Sections 406.3.1 through 406.3.4. 406.3.1 Fire prevention training. Employees shall be apprised of the fire hazards of the materials and processes to which they are exposed. Each employee shall be instructed in the proper procedures for preventing fires in the conduct of their assigned duties. 406.3.2 Evacuation training. Employees shall be familiarized with the fire alarm and evacuation signals, their assigned duties in the event of an alarm or emergency, evacuation routes, areas of refuge, exterior assembly areas and procedures for evacuation.
- 31. Multiple units Bathroom NEC 406.3(b) A nongrounding -type receptacle(s) shall be permitted to be replaced with a ground-fault circuit interrupter-type of receptacle(s). These receptacles shall be marked 'No Equipment Ground.' An equipment grounding conductor shall not be connected from the ground-fault circuit interrupter-type receptacle to any outlet supplied from the ground-fault circuit-interrupter receptacle. -Provide no equipment ground label on the outlets in the following units: 12, 15, 16, 19, 20, 24, 23, 25, 30, 32, 33, 34, 35, 36, 37, 38, 39, 40, and 41.
- 32. Office Missing switch cover MSFC 604.6 Provide electrical cover plates to all outlets, switches and junction boxes where missing.

33. Owner information - Required - SPLC Chapter 40.04 (b) Information and application. Owners of all buildings subject to the fire certificate occupancy requirement shall apply for a fire certificate of occupancy. The application shall include, at a minimum, the following information: (2) The name, address and twenty-four (24) hour telephone numbers of the owner(s); (3) The name, address and telephone numbers of the property manager(s) or responsible party.-

Included in this report is the change of responsible party information and contacts for the property. Please fill this out with the appropriate contact information for the person in charge and return to the fire inspector for entry into the city database as contact for the property.

34. SPLC 39.02(c) - Complete and sign the smoke alarm affidavit and return it to this office.

Saint Paul Legislative Code authorizes this inspection and collection of inspection fees. For forms, fee schedule, inspection handouts, or information on some of the violations contained in this report, please visit our web page at: http://www.stpaul.gov/cofo

You have the right to appeal these orders to the Legislative Hearing Officer. Applications for appeals may be obtained at the Office of the City Clerk, 310 City Hall, City/County Courthouse, 15 W Kellogg Blvd, Saint Paul MN 55102 Phone: (651-266-8585) and must be filed within 10 days of the date of the original orders.

If you have any questions, email me at george.niemeyer@ci.stpaul.mn.us or call me at 651-266-8991 between 7:30 a.m. - 9:00 a.m. Please help to make Saint Paul a safer place in which to live and work.

Sincerely,

George Niemeyer Fire Safety Inspector Ref. # 14437